












119-675-012

Dart Aerospace Ltd.

Date: Thursday, 19/03/2009 11:02:01 AM
 User: Julie Dawson

Process Sheet

Customer	: CU-DAR001 Dart Helicopters Services	Drawing Name	: A119 STEP WELDMENT RH
Job Number	: 46572A		
Estimate Number	: 10130		
P.O. Number	:	Part Number	: D3043042
This Issue	: 19/03/2009 S.O. No. :	Drawing Number	: D3043 REV A
Prsht Rev.	: NC	Project Number	: N/A
First Issue	: / / Type : LARGE FAB ASSY	Drawing Revision	: A
Previous Run	: 42917A	Material	:
Written By	:	Due Date	: 10/04/2009 Qty: 4 Um: Each
Checked & Approved By	: <u>JUD 09.03.19</u>		
Comment	: Est Rev :A New Issue JLM 05-11-01		
Additional Product			
Job Number: 			
Seq. #:	Machine Or Operation:	Description :	
✓ 1.0	D2622120C	Step Extrusion	
			
Comment: Qty.: 1.0000 Each(s)/Unit Total : 4.0000 Each(s) Pick: D2622-120C extrusion Batch: <u>44064</u> SAP 09-03-19 (4)			
2.0	LARGE FAB 1	LARGE FABRICATION RESOURCE 1	
			
Comment: LARGE FABRICATION RESOURCE 1 1-Cut D2622-120 extrusion to 120.00" long as per Dwg D3043 using cutting table setup DT8185-G 2-Deburr and bevel ends for welding SAP 09-03-19 (4)			
3.0	QC5	INSPECT WORK TO CURRENT STEP	
			
Comment: INSPECT WORK TO CURRENT STEP SAP 09-03-19 (4)			
4.0	D2734	Step End Plate	
			
Comment: Qty.: 2.0000 Each(s)/Unit Total : 8.0000 Each(s) Pick: Qty Part Number Description Batch 2 D2734 End Cap <u>343535</u> SAP 09-03-24			
5.0	D30401	Mounting Lug	
			
Comment: Qty.: 2.0000 Each(s)/Unit Total : 8.0000 Each(s) Pick: Qty Part Number Description Batch 2 D3040-1 Mounting Lug <u>342944</u> SAP 09-03-24			

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 19/03/2009 11:02:02 AM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: A119 STEP WELDMENT RH

Job Number: 46572A

Part Number: D3043042

Job Number:



Seq. #:

Machine Or Operation:

Description :

6.0

D30403

Mounting Lug



Comment: Qty.: 2.0000 Each(s)/Unit Total : 8.0000 Each(s)

Pick:

Qty Part Number Description Batch

2 D3040-3 Mounting Lug 842945

PH 09.03.24

7.0

LARGE FAB 1

LARGE FABRICATION RESOURCE 1



Comment: LARGE FABRICATION RESOURCE 1

1-Weld 1 End Cap & Mounting Lugs as per QSI 004 & Dwg D3043 Using DT8808

AR AL ROD Batch: M110431
M110130

2-Grind Fwd End Cap weld flush

PH 09.03.25

8.0

QC9

VISUAL WELDING INSPECTION



Comment: VISUAL WELDING INSPECTION

PD 09-03-25

9.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

509/03/25 (x4RH)

10.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

1-Chemical Conversion Coat as per QSI 005 4.1

SAD 09-03-25 (4)

11.0

LARGE FAB 1

LARGE FABRICATION RESOURCE 1



Comment: LARGE FABRICATION RESOURCE 1

1-1-Weld 1 End Cap as per QSI 004 & Dwg D3043

AR AL ROD Batch: M110130

2-Inspect for foreign object as per QSI 024

PH 09.03.26
PH 09.03.27

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 19/03/2009 11:02:02 AM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: A119 STEP WELDMENT RH

Job Number: 46572A

Part Number: D3043042

Job Number:



Seq. #:

Machine Or Operation:

Description :

3-Grind Fwd End Cap weld flush

FL 09.03.27 4

12.0

QC9

VISUAL WELDING INSPECTION



Comment: VISUAL WELDING INSPECTION

PD 09-03-29

13.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

S 09/03/30 (4) 124

14.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

FL 09/03/31 (4)

1-Touch up Chemical Conversion Coat as per QSI 005 4.1

15.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

Inspect alodine

BR 09-04-1 (4)

16.0

POWDER COATING

POWDER COATING



Comment: POWDER COATING

Powder Coat White Gloss (Ref: 4.3.5.1) as per QSI 005 4.3

START TIME:

10:45

OVEN TEMPERATURE:

320°

FINISH TIME:

17:15

BR 09-04-1 (4)

17.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

m/09917

1-Wing Walk as per Dwg D3043 and QSI 005 4.4

FL 09/04/01

18.0

QC3

INSPECT POWDER COAT/CHEMICAL CONVERSION



Comment: INSPECT POWDER COAT/CHEMICAL CONVERSION

S 09/04/09 (4) 124

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 19/03/2009 11:02:02 AM
User: Julie Dawson

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: A119 STEP WELDMENT RH

Job Number: 46572A

Part Number: D3043042

Job Number:



Seq. #:

Machine Or Operation:

Description :

19.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and Stock
Location: *9/4/9*

42

50

20.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

09/04/14

Job Completion



mf
09-04-09

W/O:		WORK ORDER CHANGES						
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector	

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries



DESIGN <i>CP</i>	DRAWN BY <i>CP</i>	DART AEROSPACE USA, INC. PORT HADLOCK, WA	
CHECKED <i>[Signature]</i>	APPROVED <i>[Signature]</i>	DRAWING NO. D3043	REV. A SHEET 1 OF 2
DATE 01.06.28		TITLE A119 STEP WELDMENT	SCALE NTS
A	01.06.28	NEW ISSUE	

PARTS LIST:

Qty -041	Qty -043	Part Number	Description
X		D3043-041	STEP WELDMENT, LH
	X	D3043-042	STEP WELDMENT, RH
1	1	D2622-120	STEP EXTRUSION
2	2	D3040-1	MOUNTING LUG
2	2	D3040-3	MOUNTING LUG
2	2	D2734	ENDPLATE

NOTES:

- 1) MANUFACTURE FROM D2622-120 EXTRUSION
- 2) WELD PER DART QSI 004. ALL WELDS SHOULD BE 100% VISUALLY INSPECTED BY A QUALIFIED INSPECTOR PER DART QSI 004
- 3) FINISH: ACID ETCH & ALODINE ASSEMBLY PER DART QSI 005 4.1
POWDER COAT WHITE (REF 4.3.5.1) PER DART QSI 005 4.3
BLACK ANTI-SKID PAINT TOP SURFACE OF STEP TO BOTTOM OF TOP
RADIUS PER DART QSI 005 4.4
- 4) ALL DIMENSIONS ARE IN INCHES
- 5) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED

RELEASED
01.07.05


SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. *4652A*

Copyright © 2001 by DART AEROSPACE USA, INC.


THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.



DESIGN <i>CP</i>	DRAWN BY <i>CP</i>	DART AEROSPACE USA, INC. PORT HADLOCK, WA	
CHECKED <i>#</i>	APPROVED <i>#</i>	DRAWING NO. D3043	REV. A SHEET 2 OF 2
DATE 01.06.28		TITLE A119 STEP WELDMENT	SCALE 1:5
A	01.06.28	NEW ISSUE	

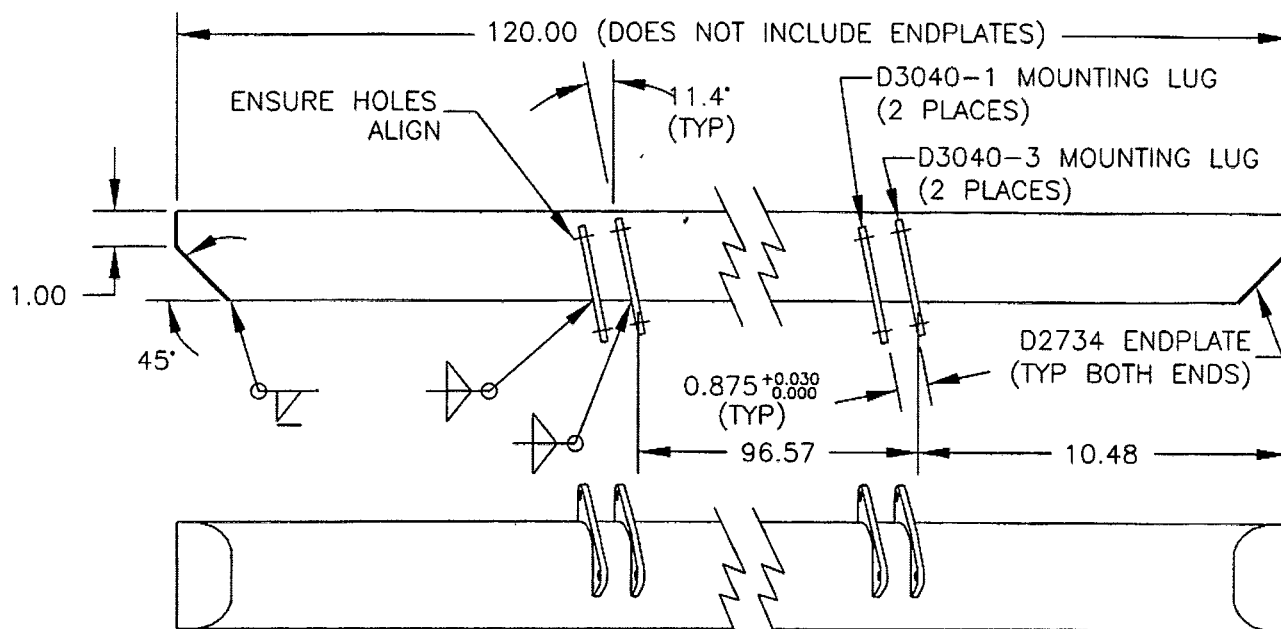

VIEW A-A: D3043-041 LH STEP WELDMENT

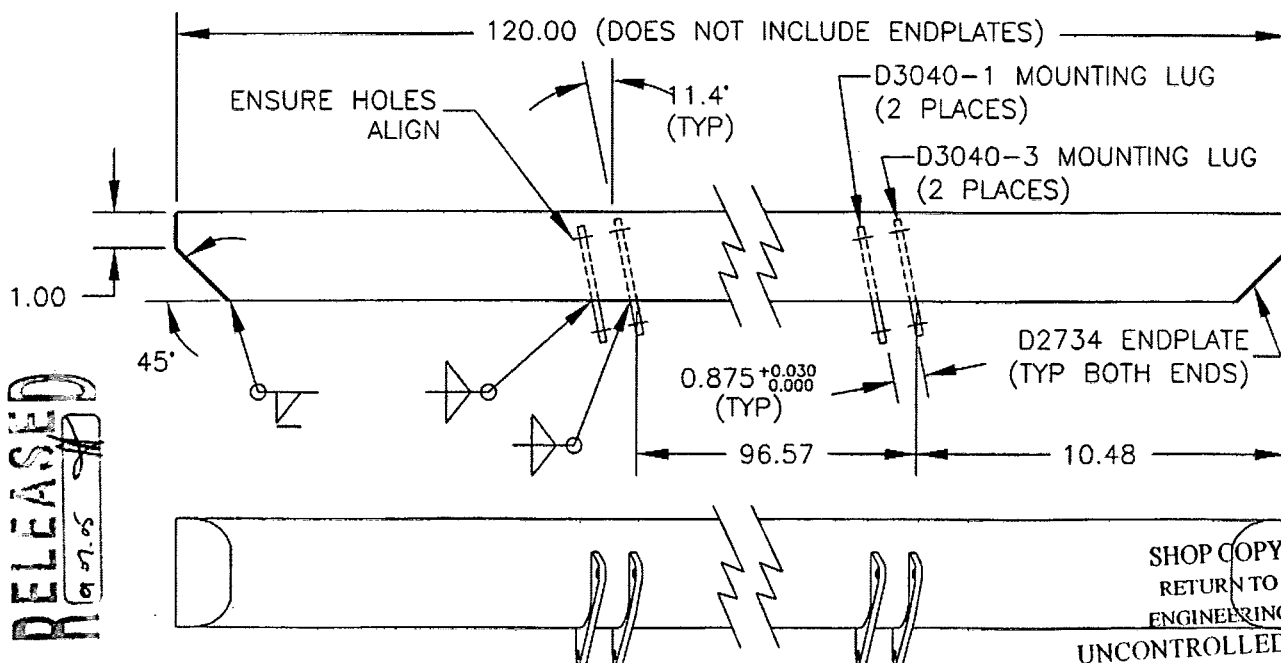

VIEW A-A: D3043-042 RH STEP WELDMENT

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE

Copyright © 2001 by DART AEROSPACE USA, INC.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

RELEASED
R 07.05

WORK ORDER
1005720